



Release Note QX2000 6.1.10 Edition 1

THIS DOCUMENT CONTAINS CONFIDENTIAL AND PROPRIETARY INFORMATION OWNED BY EPYGI TECHNOLOGIES, LTD. ANY COPYING, USE OR DISCLOSURE OF THE DOCUMENT OR THE INFORMATION CONTAINED HEREIN WITHOUT THE WRITTEN PERMISSION OF EPYGI TECHNOLOGIES, LTD. IS STRICTLY PROHIBITED.

THIS DOCUMENT IS PROVIDED TO YOU FOR INFORMATIONAL PURPOSES ONLY. The information furnished in this document, believed by Epygi Technologies to be accurate as of the date of publication, is subject to change without notice. Epygi Technologies assumes no responsibility for any errors or omissions in this document and shall have no obligation to you as a result of having made this document available to you or based upon the information it contains.

Epygi, Quadro and QX are registered trademarks of Epygi Technologies, LTD. All other products and services are the registered trademarks of their respective holders.

1 Introduction

This Release Note describes hardware and software requirements to use with the

QX2000 software 6.1.10 Date: October 30, 2015

Additional enhancements, bug fixes and known issues incorporated in this software will be listed as known.

Date: October 30, 2015

2 Requirements

2.1 Hardware Requirements

- The software (SW) can be used on all QX2000 models.
- The model name is written on the back plate of the unit and the model number is on the bottom label.

2.2 Software Requirements

Attention: The software upgrade can be made from 6.0.1 or later software. If the QX2000 is running on a SW version lower than 6.0.1 then 6.0.1 needs to be installed from scratch. For details on the installation procedure, see [Upgrading Instructions](#) section.

2.3 Supported IP Phones

Listed below are the Epygi Supported IP phones with the corresponding firmware (FW) versions that are tested and recommended for use with QX2000 SW 6.1.10. All the phones in this list can be automatically configured to work with QX2000 SW 6.1.10.

Please Note: For most IP phones the QX2000 supports both the Plug-and-Play (PnP) and the auto configuration options. For some specific phones only the auto configuration option is supported. The configuration options for each specific IP phone is described in detail in [Configuring Epygi Supported IP Phones](#) document.

Please Note: Any known issues and limitations regarding the usage of the QX2000 SW 6.1.10 telephony services and features for each IP phone is described in detail in the [QX IP PBX Features on Epygi Supported IP Phones List](#) document.

Both mentioned documents are available at www.epygi.com and can be found under the Support Portal.

Vendor	Model	Software Version
Aastra	6757iCT(57iCT)	3.3.1.2256-SIP
Aastra	9480iCT(35iCT)	3.3.1.2256-SIP
Akuvox	SP-R53P	53.0.1.23
Alcatel	IP2015	1.0.7A-0
Alcatel	Temporis IP100	1.0.6A-0
Alcatel	Temporis IP150	1.0.6A-0
Alcatel	Temporis IP200	13.60.0.89
Alcatel	Temporis IP300	1.0.7B-0
Alcatel	Temporis IP600	14.60.0.89
Alcatel	Temporis IP700G	1.0.7A-0
Alcatel	Temporis IP800	15.60.0.89
AudioCodes	310HD	1.6.0_build_37
AudioCodes	320HD	1.6.0_build_37
Cisco	SPA303	7.4.9c
Cisco	SPA501G	7.4.9c
Cisco	SPA509G	7.4.9c
Cisco	SPA525G2	7.4.9c
Fanvil	C58/C58P	2.3.233.129
Fanvil	C62/C62P	2.3.235.128
Fanvil	C400	11.20.12.2.B

Vendor	Model	Software Version
Fanvil	C600	11.20.12.2.B
Fanvil	F52/F52P	2.3.123.78
Fanvil	X3/X3P	1.3.221.1531
Fanvil	X5/X5G	1.3.115.1425
Grandstream	GXP1100	1.0.6.7
Grandstream	GXP1105	1.0.6.7
Grandstream	GXP1160	1.0.6.7
Grandstream	GXP1165	1.0.6.7
Grandstream	GXP1400	1.0.6.7
Grandstream	GXP1405	1.0.6.7
Grandstream	GXP1450	1.0.6.7
Grandstream	GXP2000	1.2.5.3
Grandstream	GXP2100	1.0.6.7
Grandstream	GXP2110	1.0.6.7
Grandstream	GXP2120	1.0.6.7
Grandstream	GXP2124	1.0.6.7
Grandstream	GXP2130	1.0.3.9
Grandstream	GXP2140	1.0.3.9
Grandstream	GXP2160	1.0.3.9
Grandstream	GXP2200	1.0.3.25
Grandstream	GXV3140	1.0.7.3
Grandstream	GXV3175	1.0.3.22
Mitel (Aastra)	6730i	3.3.1.4305-SIP
Mitel (Aastra)	6731i	3.3.1.4305-SIP
Mitel (Aastra)	6735i	3.3.1.8140-SIP
Mitel (Aastra)	6737i	3.3.1.8140-SIP
Mitel (Aastra)	6739i	3.3.1.4305-SIP
Mitel (Aastra)	6753i	3.3.1.4305-SIP
Mitel (Aastra)	6755i	3.3.1.4305-SIP
Mitel (Aastra)	6757i	3.3.1.4305-SIP
Mitel (Aastra)	6863i	4.0.0.92-SIP
Mitel (Aastra)	6865i	4.0.0.92-SIP
Mitel (Aastra)	6867i	4.0.0.92-SIP
Mitel (Aastra)	9143i	3.3.1.4305-SIP
Mitel (Aastra)	9480i	3.3.1.4305-SIP
Panasonic	KX-TGP550T04	12.17
Panasonic	KX-UT123	01.061
Panasonic	KX-UT123NE	01.221
Panasonic	KX-UT136	01.061
Polycom	SoundPoint IP 330SIP*	3.3.5.0247
Polycom	SoundPoint IP 331SIP*	3.3.5.0247
Polycom	SoundPoint IP 335SIP*	3.3.5.0247
Polycom	SoundPoint IP 450SIP*	3.3.5.0247
Polycom	SoundPoint IP 550SIP*	3.3.5.0247
Polycom	SoundPoint IP 650SIP*	3.3.5.0247
Polycom	SoundPoint IP 670SIP*	3.3.5.0247
Polycom	SoundStation IP 5000*	3.3.5.0247
Polycom	SoundStation IP 6000*	3.3.5.0247
Polycom	VVX 1500*	3.3.5.0247

Vendor	Model	Software Version
Polycom	VVX 300/310	4.1.7.1210
Polycom	VVX 400/410	4.1.7.1210
Polycom	VVX 500	4.1.7.1210
Polycom	VVX 600	4.1.7.1210
snom	300	8.4.35
snom	320	8.4.35
snom	360	8.4.35
snom	370	8.4.35
snom	710	8.7.3.25.9
snom	720	8.7.3.25.9
snom	760	8.7.3.25.9
snom	821	8.4.35
snom	870	8.4.35
snom	D715/715	8.7.5.17
snom	D725	8.7.5.17
snom	m9	9.4.7
snom	MeetingPoint	8.4.35
snom	M700	03.24.0007
snom	PA1	8.4.35
Spectralink	KIRK Wireless Server 300	PCS14C_
Spectralink	KIRK Wireless Server 6000	PCS14C_
Yealink	SIP-T19P	31.72.0.1
Yealink	SIP-T19P E2	53.80.0.60
Yealink	SIP-T20P	9.72.0.1
Yealink	SIP-T21P	34.72.0.1
Yealink	SIP-T21P E2	52.80.0.60
Yealink	SIP-T22P	7.72.0.1
Yealink	SIP-T23G(P)	44.80.0.60
Yealink	SIP-T26P	6.72.0.1
Yealink	SIP-T27P	45.80.0.60
Yealink	SIP-T28P	2.72.0.1
Yealink	SIP-T32G	32.70.0.130
Yealink	SIP-T38G	38.70.0.125
Yealink	SIP-T41P	36.72.0.1
Yealink	SIP-T42G	29.72.0.1
Yealink	SIP-T46G	28.72.0.1
Yealink	SIP-T48G	35.72.0.34
Yealink	VP-530	23.70.0.40
Yealink	W52P	25.30.0.20

Please Note: QX2000 IP phones firmware control mechanism will not upgrade snom FW version from 6.x to 7.x. This should be done manually via snom web site. Once the snom FW version is 7.x, the QX's FW control will automatically upgrade/downgrade the phone to Epygi's recommended FW version but not to 6.x.

Please Note: In the model's list the Polycom phones with (*) sign are also presented as Polycom-xx-Pre-3.3.0 due to backward incompatibility of UC Software 3.1.1 configuration. It is recommended to use Pre-3.3.0 models with Application SIP software 3.2.2.0477.

2.4 Interaction with Other Epygi Software Releases

- QXISDN4, QXE1T1 or QXFXO4 gateways used in the shared mode should have SW 6.1.5 or higher to achieve maximum feature functionality with the QX2000 SW 6.1.10.
- QXFXS24 should have SW 6.1.5 or higher for PnP configuration to achieve maximum feature functionality with the QX2000 SW 6.1.10.
- ActiveX Control SW 5.7.0 or higher should be used with 3PCC functions with the QX2000 SW 6.1.10.
- Auto Dialer SW 1.0.11 or higher should be used with the QX2000 SW 6.1.10.
- Desktop Communication Console (DCC) SW 1.13 or higher should be used with the QX2000 SW 6.1.10.
- QX-Quadro Configuration Console (QCC) SW 2.1 or higher should be used with the QX2000 SW 6.1.10.
- HotCall Add-In SW 2.3 or higher should be used with the QX2000 SW 6.1.10.
- HotKeyCall SW 1.10 or higher should be used with the QX2000 SW 6.1.10.
- To use QX2000 SW 6.1.10 with a 3PCC or Click2Dial application the 3pcc/Click2Dial Access Allowed checkbox should be enabled for each extension(s) using this feature.
- Epygi Media Streamer (EMS) SW 2.4 or higher should be used with the QX2000 SW 6.1.10.
- Epygi Hotel Console (EHC) SW 1.0.7 or higher should be used with the QX2000 SW 6.1.10.

Important Note: QX2000 SW 6.1.2 and higher is not compatible with ACD Service and Statistics Monitoring and Reporting (SMR) system. The replacement for SMR is the Epygi ACD Console (EAC) web application. EAC requires a software license key.

3 New Features History

The table below indicates a high-level list of new features that have been added beginning with the most recent QX2000 SW release.

Release	New Features
6.1.10	Added auto configuration support for the new Yealink SIP-T19P E2, T21P E2, T23G(P) and T27P IP phones.
	Added OpenVPN support, which allows secure point-to-point or site-to-site connections in routed or bridged configurations between the QX50/QX200 and other devices and remote access facilities.
	Added support for the new Epygi Hotel Console (EHC) application (with a license key).
	Added new Alarm feature. This feature allows to be schedule alarms for each extension. The configured alarm will be automatically activated at the scheduled time.
	Added support for Barge-In, Whisper and Listen-In features from EAC web GUI.
	Added Reporting feature in the EAC application that allows reports to be generated and downloaded in a CSV format related to the ACD statistics and CDR records.
	Added support for direct outbound/inbound calls from/to agents along with the ACD call statistics and CDR records for these calls.
	Added a new ACD Service in the Firewall→Management Access to allow remote access to the EAC application from the WAN.
	Added a new EHC Service in the Firewall→Management Access to allow remote access to the EHC application from the WAN.
6.1.5	Added auto configuration support for the new Alcatel Temporis IP100, IP150, IP300, IP700G IP phones and Alcatel IP2015 DECT phone.
	Added PnP and auto configuration support for the new snom D715/715 and D725 IP phones.
6.1.2	Added support for the new Epygi ACD Console web application (with a license key), which allows call center agents, supervisors and administrators to monitor the queues and agents, to view call statistics, to chat and to update the agents' status, etc. EAC stores and formats the data and produces real-time information and statistical reports on ACD activities.
	Added Phone Book support, which allows external contacts to be easily added into the IP Phones' Directory.
	Added a new Recording tool , which allows system voice messages to be directly recorded from an IP phone.
	Added auto configuration support for the new Fanvil X3/X3P, X5/X5G, C400 and C600 IP Phones.
	Added PnP and auto configuration support for the new snom M700 Base Station.
	Added Play Ringback Tone option in Find Me/Follow Me (FM/FM), which allows a ringback to be played during the Welcome Message Delay and Audio Wait period.
	Added a new configuration option in the IP Phone templates to allow the Record button functionality for snom phones to be enabled/disabled.
	Added the Live Dialpad option for Yealink phones in IP Phone templates.
	Added Caller ID Source parameter for Yealink phones in IP Phone templates.
Added BLF LED Mode states to be optioned for Yealink phones (except Yealink SIP-T19P) in IP Phone templates.	
6.0.8	Added an additional option to verify the status for trial and time limited features keys.

Release	New Features
6.0.7	Added PnP and auto configuration support for the new Mitel (Aastra) 6863i, 6865i, 6867i IP Phones.
	Added PnP support for Cisco SPA IP phones: 303, 501, 509 and 525.
	Added programmable keys configuration support for Cisco SPA IP phones: 303, 501, 509 and 525.
6.0.6	
6.0.5	PnP and auto configuration support for new Yealink SIP-T48G phone.
	Expansion module EXP39 support for Yealink SIP-T26P, SIP-T28P and SIP-T38P phones.
6.0.2	

4 Changed Features History

The table below provides a high-level list of changed features that have been changed beginning with the most recent QX2000 SW release.

Release	Changed Features
6.1.10	The maximum count for IP Phones trial feature has been changed from 99 to 1800 .
	Added support in Extensions Multiple Editing for the following fields: Call Barge-In / Intercept Access List from General Settings page.
	The behavior for the VoIP Carrier Wizard is changed. The new Authentication by IP Address checkbox allows bypassing the Account Name and Password information and filling the SIP Server and SIP Server Port information only for the carriers not requiring account authentication.
	Added BINARY NETWORKS as a new carrier to the VoIP Carrier Wizard list.
	Added Blueface Ireland , Blueface Italy and Blueface UK as new carriers to the VoIP Carrier Wizard list.
	Added IP Directions as a new carrier to the VoIP Carrier Wizard list.
	Added MyNetFone as a new carrier to the VoIP Carrier Wizard list.
	Added ThinkTel Communications as a new carrier to the VoIP Carrier Wizard list.
	Kebu.it carrier has been removed from the VoIP Carrier Wizard list.
	Consultative call transfer action has been removed from EAC→Dashboard page.
	The old password will not be required to insert when you change Phone Access Password for Administrator.
The LAN IP address of the restored configuration file will be displayed in the shell window, while restoring previously backed up configuration file.	
6.1.5	In addition to expiration period the expiration date/time has been displayed for time-limited license keys in Licensed features table.
	Added support in Extensions Multiple Editing for the following fields: Password and Confirm password from General Settings page and Authentication User Name from SIP Advanced settings.
	No Answer Call Forwarding (NACF) enhancement for FM/FM. Unanswered FM/FM call will be forwarded to NACF destination's Voice Mailbox.

Release	Changed Features
6.1.2	<p>The ACD system has been completely redesigned for QX2000 SW 6.1.2. The SMR system isn't compatible with QX2000 SW 6.1.2 and higher software. The replacement for SMR is the new Epygi ACD Console web application. EAC requires a software license key.</p> <p>Please Note: In general, most of the ACD configuration settings will remain while updating to SW 6.1.2 and higher. The ACD settings should be reviewed before and after the update as new fields will be added in SW 6.1.2.</p>
	<p>If an ACD Agent rejects a call by pressing the Reject button on the phone, then that call will not ring the agent's phone again within the Queue Ring timeout duration.</p>
	<p>When an ACD Agent receives a call and doesn't answer within the Agent Ring timeout, the agent state will change to Away. Either the Agent or the Supervisor will need to change the agent's status back to Online.</p>
	<p>Added Ring Duration option for each FM/FM destination. The Ring Duration is used to select the ringing timeout of the destination.</p>
	<p>Loadlogo.cgi hidden page (for updating company details) has been renamed/changed to uploadlogo.cgi</p>
	<p>Recommended firmware versions for Grandstream GXP 1400, 1405, 1450, 2100, 2110, 2120, 2124 have been changed from 1.0.4.9 to 1.0.6.7.</p>
	<p>Recommended firmware versions for snom 710, 720, 760 have been changed from 8.7.3.15 to 8.7.3.25.9.</p>
	<p>Recommended firmware versions for Aastra 6757iCT, 9480iCT have been changed from 2.6.0.2019-SIP to 3.3.1.2256-SIP.</p>
	<p>Recommended firmware versions for Mitel (Aastra) 6730i, 6731i, 6753i, 6755i, 6757i, 9143i, 9480i have been changed from 2.6.0.2019-SIP to 3.3.1.4305-SIP.</p>
	<p>Recommended firmware version for Mitel (Aastra) 6739, has been changed from 3.2.2.2088-SIP to 3.3.1.4305-SIP.</p>
6.0.8	<p>Recommended firmware versions for Mitel (Aastra) 6735i, 6737i have been changed from 3.2.2.7137-SIP to 3.3.1.8140-SIP.</p>
6.0.7	<p>Aastra IP phones (6730i, 6731i, 6735i, 6737i, 6739i, 6753i, 6755i, 6757i, 6863i, 6865i, 6867i, 9143i, 9480i) have been renamed to Mitel (Aastra) 6730i, 6731i, 6735i, 6737i, 6739i, 6753i, 6755i, 6757i, 6863i, 6865i, 6867i, 9143i and 9480i.</p>
	<p>Polycom KIRK Wireless Server 300, KIRK Wireless Server 6000 stations have been renamed to Spectralink KIRK Wireless Server 300 and Spectralink KIRK Wireless Server 6000 accordingly.</p> <p>Please Note: QX2000 doesn't support the KWS's redundancy feature for these stations.</p>
	<p>The max number of Line appearance for SPA525G2 is changed from 2 to 10.</p>
	<p>New parameters have been added to Aastra IP phones templates.</p>
	<p>Recommended firmware versions for Grandstream GXP2130, GXP2140 and GXP2160 have been changed from 1.0.2.9 to 1.0.3.9.</p>
	<p>Changed the behavior for Polycom phone display in case of incoming calls to watched extensions. Show or not the call appearance/caller's ID on incoming calls to watched extensions is configurable now in the IP phones templates.</p>
6.0.6	
6.0.5	
6.0.2	

5 Fixed Issues

Issues fixed since version 6.1.5:

T: Title

D: Description

19309	T:	The Shared Voice Mailbox BLF key doesn't work properly on Cisco SPA phones
	D:	When you press Shared Voice Mailbox key, the IP phone send *85 only and you need to enter extension number.
19214	T:	SIP IDS functionality issue
	D:	The IP address must be blocked and added into Firewall's Blocked IP List after 10 continuous failed attempts of SIP Registration, but is blocked and added only after 11 attempts.
19207	T:	"Symmetric RTP" doesn't work properly on QX2000
	D:	
19179	T:	SRTP support on snom D715/715 and D725 has been temporarily disabled.
	D:	Snom D715/715 and snom D725 forced to make only secure calls by default, even though QX2000's default SRTP settings for Extension is Make unsecure calls, accept anything and snom's default SRTP policy set to Optional .
19144	T:	QX2000 with QXISDN GW share mode issue
	D:	QX2000 is connected with QXISDN GW using share mode option. ISDN trunks mode couldn't be change from User to Network from QX2000's ISDN Trunk Settings page, using ISDN Wizard.

6 Known Issues

T: Title
 D: Description
 C: Consequences
 Fix: How to avoid the situation, or what to do in case the situation has occurred

19167	T:	AudioCodes 310HD and 320HD IP phones are forced to make only secure calls by default, even though QX2000's default SRTP settings for attached extension is "Make unsecure calls, accept anything"
	D:	
	C:	The outgoing calls cannot be established.
	Fix:	Go to the Codec Settings for the extension attached to that phone, select Make and accept only unsecure calls option in the Secure RTP Settings and reset the phone to factory defaults. Will be fixed in the future releases.
18986	T:	Paging doesn't work for Parent/child extensions
	D:	
	C:	
	Fix:	Will be fixed in the future releases.
18959	T:	Phone book isn't available on Yealink T4x phones at once
	D:	After factory reset on Yealink T4x phones, phone book will not appear in phone directory on the IP phones.
	C:	
	Fix:	Workaround: The phone book will appear after making changes in Phone book directory, example adding a new extension to Public Directory and rebooting phones. Will be fixed in the future releases.
18839	T:	It's not possible to park a call twice to the same call park extension by using programmable key on Yealink T32G and T38G
	D:	Upon successful call park/pickup the second attempt to park the call, using the park ext. programmable key fails. The problem is happening only if we park the call to the same park extension (by pressing Call Park key).
	C:	
	Fix:	Workaround: Park the call to a different call park extension. Will be fixed in the future releases.
18707	T:	An issue with extension watching on Fanvil C62 phone
	D:	If a programmable key is configured to watch an extension you cannot pickup the call addressed to that extension by pressing the key.
	C:	
	Fix:	Will be fixed in the future releases.
18638	T:	When opening the Call History, sometimes it doesn't show CDR records but shows an empty page
	D:	Only after refreshing the page it shows the CDRs.
	C:	
	Fix:	Will be fixed in the future releases.
18591	T:	GXP2200, GXV3175 and GXV3140 IP phones are forced to make secure calls by default, even though in phone Web GUI the SRTP Mode is configured as "Enabled but not forced"
	D:	
	C:	The outgoing calls cannot be established.

	Fix:	Go to the Codec Settings for the extension attached to that phone, select Make and accept only unsecure calls option in the Secure RTP Settings and reset the phone to factory defaults. Will be fixed in the future releases.
18559	T:	There is no audio when using service codes like *74,*75,*4 on Astra 6739i IP phone in case if SRTP Policy is set as "Make and accept only secure calls" on the phone extension
	D:	
	C:	
	Fix:	Will be fixed in the future releases.
18549	T:	Could not dial out (*1) or use any other moderator feature while welcome message file has been playing
	D:	Could not dial out (*1) or use other moderator features while welcome message file has been playing. You should listen to the whole welcome message file first, after that use moderator features. It is recommended to keep the welcome message to a short duration.
	C:	
	Fix:	Will be fixed in the future releases.
18548	T:	Part of conference recording is lost after recording pause/resume
	D:	When pausing the conference recording and then resuming it again, the final recording contains only the part after resuming.
	C:	
	Fix:	Will be fixed in the future releases.
18528	T:	In shared mode, E1/T1 trunk link is not available in Status→System Status→Lines page
	D:	
	C:	
	Fix:	Will be fixed in the future releases.
18419	T:	Cannot establish call if you change signaling type for time slots using CAS Signaling Wizard
	D:	
	C:	
	Fix:	Workaround: Need to stop/start E1 trunk to make a call. Will be fixed in the future releases.
18397	T:	After changing the Time/Date Settings manually, it takes you to the QX IP PBX login page
	D:	
	C:	
	Fix:	Will be fixed in the future releases.
18372, 17709	T:	A problem with configuring programmable keys in IP line Advanced Settings page for Grandstream GXP2124, GXP 2140 and GXP2160 phones
	D:	If the Programmable Keys configuration page for GXP2124, GXP2140 and GXP2160 phones has all six Line keys configured with some functions the phones becomes nonfunctional: the dial tone is lost, the keys and buttons on phone keypad stop working.
	C:	
	Fix:	Do not use all six line keys when configuring programmable keys. Keep at least two line keys unused to be able to make/receive calls. Or use Multi-Purpose Keys instead. Will be fixed in some future FW version for the mentioned phones.
18186	T:	A fake error message when pressing successful calls tab in Call History

	D:	When pressing this tab just after a successful call termination, sometimes the following error is displayed: Log file seems to be corrupted. Please clear all records. Pressing the same tab again resolves the issue.
	C:	
	Fix:	Pressing this tab once more will resolve the problem. Will be fixed in the future releases.
18112	T:	Watching does not work properly configured on Akuvox SP-R53P phone
	D:	If a programmable key is configured to watch an extension, it allows only calling to that extension. You cannot pickup the call addressed to that extension by pressing that key.
	C:	
	Fix:	Will be fixed in the future releases.
17555	T:	Using Call Intercept to directly answer an incoming ACD call fails
	D:	When ACD calls to an extension of an agent and Call Intercept is used from another extension to answer the call with the feature code (*94 + extension number), the caller hears nothing and the incoming call continues ringing. Hanging up the call from caller to direct pickup , leaves an active call.
	C:	
	Fix:	Will be fixed in the future releases.
17404	T:	Calls which are done using Call Relay (*2) on the auto attendant are not shown in Call History.
	D:	Only the call to attendant is shown in the call history. The call leg after call relay is missing in the call history in case if the external caller is terminating the call first.
	C:	
	Fix:	Use feature code *1 instead of *2 for call relay. Will be fixed in the future releases.
16683	T:	Find Me/Follow Me does not work for incoming Secure RTP call
	D:	Though the call came with SRTP option the FM/FM is making unsecure calls.
	C:	As a result the call is not established.
	Fix:	Will be fixed in the future releases.
16635	T:	Shared Mailbox watching does not work when using "Allow access to Shared Mailbox for enabled extensions" option in Many Extension Ringing configuration
	D:	Extension has Many Extension Ringing enabled with a few extensions configured for Shared Mailbox.
	C:	However, in the IP Line settings, the Shared VMail Ext. xxx option is not listed in the drop down list for Advanced Programmable Keys Configuration.
	Fix:	Use the Shared Mailbox: Edit Voice Mailbox Access List link in the Voice Mailbox Settings for extension. Will be fixed in the future releases.
16533	T:	A problem with incoming Secure RTP call in a specific scenario
	D:	When incoming Secure RTP call is connecting to the destination via Call Routing table, QX2000 always tries to connect it as an unsecure call and the call is being dropped due to the media parameters incompatibility.
	C:	
	Fix:	Will be fixed in the future releases.
16037	T:	After changing QX2000 LAN IP configuration (IP address or subnet mask) IP phones lose registration and become unusable
	D:	
	C:	

	Fix:	After changing QX2000 LAN IP configuration first reboot the unit then reboot the IP phones. Will be fixed in the future releases.
15942	T:	It is not possible to pickup (via pickup group) the call to extension with Find Me/Follow Me enabled
	D:	
	C:	
	Fix:	Will be fixed in the next releases.
15729	T:	IP phone does not go back to the normally idle state automatically when the recording had been started via the Record button and the call was released
	D:	The Recording started message remains on the phone screen after one of the parties terminates the call by going on-hook.
	C:	Only incoming calls to IP phone are possible in this state.
	Fix:	Need to use Exit button to retrieve the IP phone functionality. Will be fixed in the future releases.
14797	T:	Call Interception does not work on Grandstream GXP2000 configured as a receptionist, when extensions are watched on expansion module
	D:	
	C:	
	Fix:	Use basic seven keys instead of expansion module. Will be fixed in the future releases.
13802	T:	An issue with configuring Aastra IP phones as local extensions for QX2000 IP PBX
	D:	After changing the QX2000's LAN IP address, the Aastra 480i, 9133i and 55i phones with 1.4.1.2000 firmware are not registering after restart.
	C:	
	Fix:	They must be factory reset to register again. Will be fixed in the future FW versions for Aastra phones.
12190	T:	Some of the voice mail services could be unavailable if external Voice Mail is in use for extension
	D:	In this scenario some of the features, for example ZeroOut and entering the VMS directly with option 1 will not work.
	C:	
	Fix:	This is normal, as those features are the QX2000's internal VMS system features. If external VMS system is used, user gets the features of that external system.

7 Upgrading Instructions

7.1 General Hints

Attention: It is recommended to backup the configuration for **emergency purposes** prior to upgrading the firmware. You can do that by clicking the **Download Configuration** link in the **Firmware Update** page. Regardless, the configuration of a system will remain after the firmware update. Moreover, voice mails, all custom messages, call history and system events will be saved during the upgrade.

The following steps describe how to correctly perform the firmware update:

- Save the current configuration by doing a Backup and Download of all current configuration and voice data (**Maintenance**→**Backup/Restore**→**Backup and download current Configuration**).
- Perform the Firmware Update using the Firmware Update page.

Please Note: If the saved configuration is restored all VMs and custom messages will be lost.

Please Note: The firmware upgrade to version 6.1.x using the **Firmware Update** page can only be done starting from 6.0.1 and higher versions. If the QX2000 is running on a software version lower than 6.0.x, then 6.0.1 needs to be installed manually from scratch before updating to 6.1.x.

The steps below describe shortly the QX2000 manual installation procedure used to install the software from scratch. This would be used to install version 6.0.1 or for Emergency Recovery of a system. This procedure will result in a system that is at factory default. Additional details are available on the Epygi Channel Portal in the document [QX1000/2000 System Recovery Procedure](#):

1. Turn on the PC.
2. Insert CD/DVD disk including installation program to the DVD ROM.
3. Restart (reset) the PC.
4. Installation will start automatically after PC reboot. After the successful installation the PC will automatically shut down (this may take from 10-15 minutes).
5. The beep sound will indicate that the installation successfully completed.
6. Turn on the PC and quickly remove the installation CD/DVD disk from the DVD ROM.

7.2 Technical Advisory

Attention: For manually configured IP phones, it is now required to have the **SIP Registration Timeout** parameter set to 120 seconds or more on your IP phone. Values less than 120 seconds will not be accepted by the QX2000 and will cause the IP phone registration failure on the QX2000.

7.3 Limitations and Restrictions

- The memory used by **Network Capture** hidden page is limited to **12 MB**. This will put a limitation on the duration of captured file.
- The capture duration is limited to **160 seconds** in **DSP Capture** hidden page.
- The **Call Capture** duration is limited to **160 seconds**.
- In case if **voice mail recording codec** is other than **PCMU**, the maximum length of VM sent by email is limited to three minutes.
- The number of **VMs in the mailbox** for one extension is limited to **500**.
- **Use Session Timer** in IP Line Settings is deselected by default.